

TM65

Mid-level Report



KMDR2RSHT+AF2: 2-1Gn Kubus Cold Multideck (Roller Shutter) 838mm - Rear Doors (Self Help) + (Airflow Kit In/Out Operator Side)

Assessment Date 31/10/2025

Manufacturer CED Fabrications


Contact Email sales@cedlimited.com

Metrics

Embodied Carbon

2,348 kgCO2e

Embodied Carbon Footprint

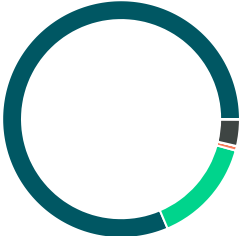

Material

Manufacture

Transport

Refrigerant

Waste

Disposal

Product Information	
Capacity of equipment/size (kW; m3; litres; etc.)	N/A
Product weight (kg)	189 kg
Material % breakdown for at least 95% of the product weight? (Y/N)	Y
Product service life (years)	10
If refrigerant based, type of refrigerant used and GWP	Propane (R 290), No refrigerant, 0.04 kgCO2e
Refrigerant charge (kg)	0.48 kg
Energy consumption of the factory* per unit of product	220 kWh
Location of manufacture*	N/A
Product complexity category	3

Page 1 of 2

Embodied carbon results (kg CO2e) – breakdown	
A1: Material extraction	1,025 kgCO2e
A2: Transport	150 kgCO2e
A3: Manufacturing	237 kgCO2e
A4: Transport to site	7 kgCO2e
A5: Construction	N/A
B1: Refrigerant leakage during use	0.38 kgCO2e
B2: Maintenance (if information given by manufacturer)	N/A
B3: Repair	323 kgCO2e
B4: Replacement	N/A
B5: Refurbishment	N/A
B6: Operational energy	N/A
B7: Operational water	N/A
C1: Refrigerant leakage when decommissioning	0.02 kgCO2e
C2: Transport	3 kgCO2e
C3: Waste processing	59 kgCO2e
C4: Disposal	0.93 kgCO2e
Embodied carbon results (kg CO2e) – without refrigerant leakage	
A1–C4 without buffer factor (excluding B1, C1)	1806 kgCO2e
A1–C4 with buffer factor (excluding B1, C1)	2348 kgCO2e
Embodied carbon result (kg CO2e) – refrigerant leakage only	
B1 (refrigerant leakage during use) + C1 (refrigerant leakage at end of life)	0 kgCO2e
Embodied carbon result with 'mid-level' calculation method – total	
Result of 'mid-level' calculation method	2,348 kgCO2e
Assumptions	
A1: Material carbon coefficient source	CIBSE TM65, Table 2.1
B1: Refrigerant annual leakage rate (%)	N/A
C1: Refrigerant end of life recovery rate (%)	N/A
B3: Materials replaced as part of repair (%)	56
C4: Percentage of product going to landfill (%)	55