


A) WORKTOP CUT-OUT


Model Ref.	Worktop Cut Out Size (mm)		Model Weight (in Kg)
	Length	Width	
KHBM2PS + KAS2PS	795	650	71
KHBM3PS + KAS3PS	1145	650	84
KHBM4PS + KAS4PS	1495	650	98
KHBM5PS + KAS5PS	1845	650	111

FIX LIFTING BRACKETS TO FRAME END FLANGES USING SCREWS ALREADY IN FLANGES, THEN LOCATE LIFTING BARS INTO SQUARE HOLES.

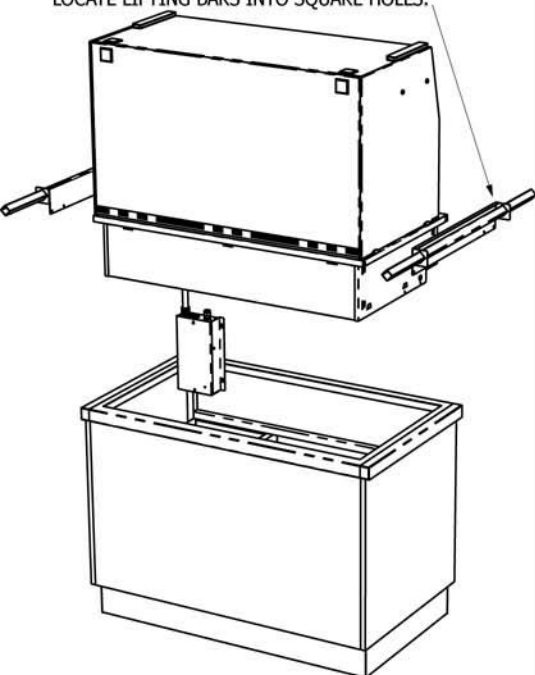

FRONT ISOMETRIC
(CUSTOMER SIDE)

B) LOCATING OF CONTROL BOX

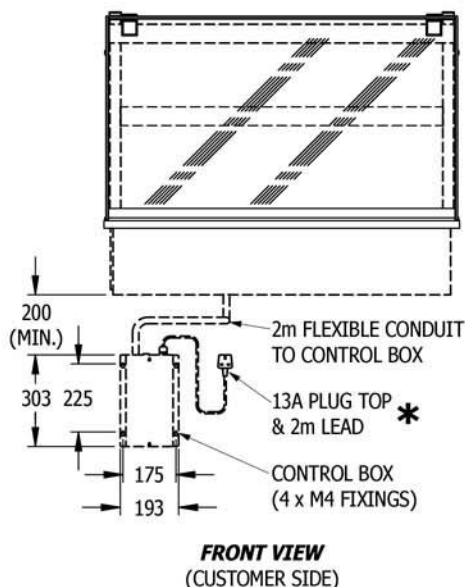

Recommended Control Box Positioning

Site the control box preferably to an upright surface, in an accessible service void, adjacent to or below the display unit (minimum clearance below underside of display unit = 200mm).

Incorrect Control Box Positioning


The control box must not be located

- 1) directly to the underside of the display unit,
- 2) above a hot cupboard or,
- 3) where ambient temperature is above 40°C,
- 4) where likely to allow ingress of water i.e. wet floor areas.

REMOVE LIFTING BRACKETS AFTER FITTING AND REPLACE SCREWS INTO FRAME END FLANGES

C) FITTING INTO COUNTER WORKTOP

SILICON SEAL AROUND DISPLAY FLANGE TO COUNTER WORKTOP

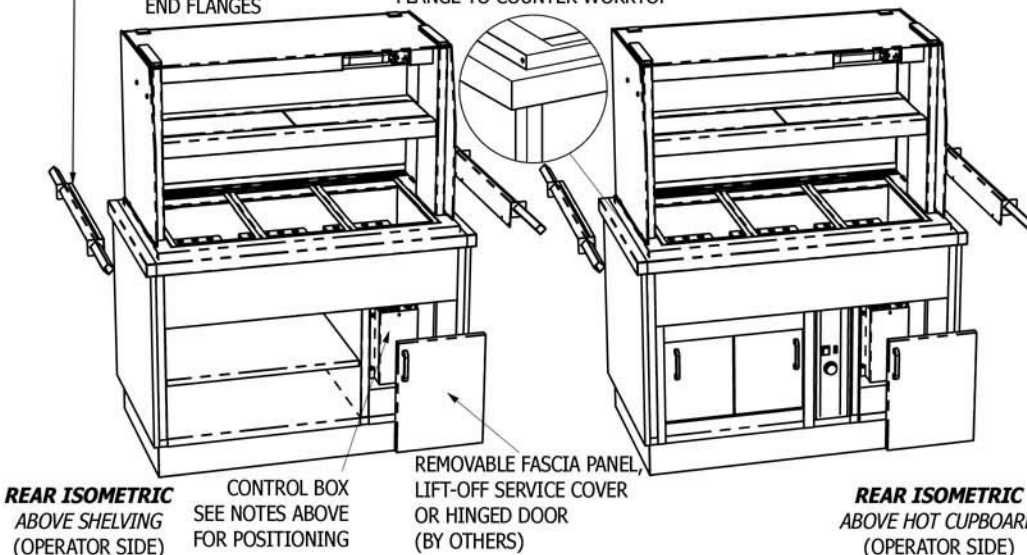

* D) FOR MODELS ABOVE 3kW

INCOMING ELECTRICAL SUPPLY DETAILS

Model Ref.	Current	Voltage	Power
KHBM3PS + KAS3PS	16A	230V	3.3kW
KHBM4PS + KAS4PS	20A	230V	4.4kW
KHBM5PS + KAS5PS	32A	230V	5.5kW

INCOMING ELECTRICAL SUPPLY
(SEE TABLE ABOVE FOR SUPPLY DETAILS)

